



## WATERPROOF DIGITAL INDICATORS FOR BORE GAUGES



**IP54**  
WATERPROOF

**DATA**  
OUTPUT

**THE ORIGINAL DATA**  
REMAINS AFTER POWER OFF

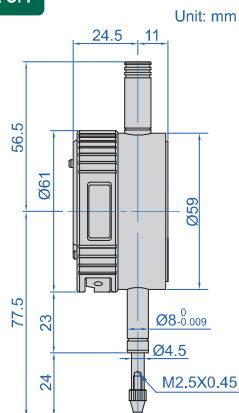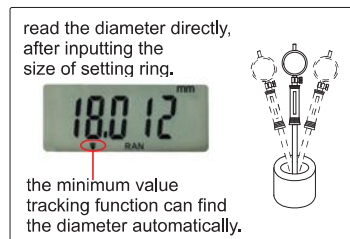

2137-10F



2137-10FWL

data transmission  
signal light

press the button  
to transmit data

- IP54 dust/waterproof (when cap is lifted, no dust/waterproof)
- Specially designed for bore gauges
- The minimum value tracking function can find the diameter automatically
- Read the diameter directly, after inputting the size of setting ring
- Button function: on/off, minimum value tracking, calibration, data preset, inch/metric conversion
- Data remains after power off, no need to recalibrate after power on
- Power supply:
  - With data interface: CR2032 battery
  - Built-in wireless: rechargeable Li-battery
- Optional accessory: backs, contact points

**With data interface**  
(optional wireless transmitter code 7315-51B, receiver is needed page 9)

Code	Range	Resolution	Accuracy	Hysteresis	Maximum measuring force	Cap	Remark
2137-10F *	12.7mm/0.5"	0.002mm/0.0001" (can switch to: 0.01mm/0.0005")	20µm	10µm	1.5N	cannot lift	flat back
2137-101F *	12.7mm/0.5"	0.001mm/0.00005"	5µm	2µm	1.5N	cannot lift	flat back

**Built-in wireless (receiver code 7315-2/3/6/7/8/9 is needed)**

Code	Range	Resolution	Accuracy	Hysteresis	Maximum measuring force	Cap	Remark
2137-10FWL *	12.7mm/0.5"	0.002mm/0.0001" (can switch to: 0.01mm/0.0005")	20µm	10µm	1.5N	cannot lift	flat back
2137-101FWL *	12.7mm/0.5"	0.001mm/0.00005"	5µm	2µm	1.5N	cannot lift	flat back

\* Supplied with manufacturer inspection certificate